

Free Stroke Analyser®

Version 2.20, November 2015


User's Manual

Revision date: 03 November 2015

Contents

1. Introduction	2
2. Technical Support	3
3. Equipment List	3
4. Safety Instructions.....	4
5. Installation	4
6. Connection Instructions.....	5
7. Care and Handling	6
8. Starting the program.....	7
9. Basic step by step procedure	8
10. Menus and Toolbar	9
10.1 File menu.....	9
10.2 Measure menu	10
10.3 View Menu.....	10
10.4 Tools menu.....	11
11. Options.....	11
12. Data Analysis Screens	13
12.1 Primary Display	13
12.2 Split Screen Display	18
13. Dynamic Measurement	18
13.1 Dynamic measurement in free stroking mode, i.e. not making cans	18
13.2 Dynamic measurement when making cans	21
14. Saving and Loading	22
15. Static Measurement	24
16. Calibration.....	26
16.1 Calibration Cradle Alignment	30
17. Set-up	32
18. Expert System.....	38

1. Introduction

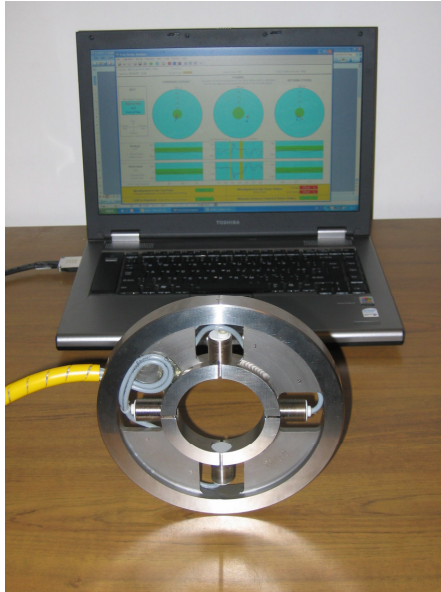

Photograph shows gauge ring to suit 8 inch diameter tool-pack.

The *Free Stroke Analyser* is a tool for the measurement of punch sleeve, ram, tool-pack/die and dome station alignment in 2-piece can bodymaker machines. The equipment comprises precision gauge equipment as well as specialised software. Its main function is to make measurements dynamically, i.e. with the bodymaker running in continuous mode, but it can also be used to measure the alignment statically.

There are several advantages in being able to measure the alignment dynamically. The most important perhaps is the fact that the alignment can be quite different when the bodymaker is running. Essentially, the dynamic measurement allows the user to see exactly where the punch and ram are going.

The Free Stroke Analyser gauge ring, which is fitted with non-contact inductive sensors, is placed in the tool-pack. The bodymaker is run without feeding in cups, i.e. in a free stroking mode, hence the name. This is in order to measure the natural path of the ram, i.e. the path the ram takes when not making cans and being forced through the centre of the dies. It is also possible, however, to obtain measurements whilst making cans. Such measurements can provide useful extra information.

The dynamic measurement not only reveals the misalignment of the tool-pack, but of the dome station as well. This is done by measuring the deflection of the ram as the punch nose enters the dome station.

The benefits that the Free Stroke Analyser can provide, include:

- More effective maintenance
- Tooling life
- Can quality (e.g. fewer split domes)
- Fewer bodymaker stoppages
- Fewer stoppages further down the line caused by poor can quality
- Spoilage
- Lightweighting programs can also be greatly assisted by its use.

2. Technical Support

Should you experience any problems with the Free Stroke Analyser or require any assistance in using it, please contact David Harvey either by phone or email. Software updates and the manual can be downloaded from the website.

Telephone contact number: +44 (0)7941 446553

E-mail Address: davidharvey@onetel.com

Website: www.deltahtechnology.co.uk

3. Equipment List

- Gauge Ring or Rings
- Calibration Cradle/s (optional)
- | | | |
|--|---|--|
| <ul style="list-style-type: none">• Data-acquisition interface box• USB cable | } | <p><u>OR (prior to April 2011)</u></p> <ul style="list-style-type: none">• <i>PCMCIA card and cable</i>• <i>Interface box and power supply</i> |
|--|---|--|
- Storage/carry case
- CD ROM containing licensed copy of Free Stroke Analyser software
- User's Manual
- Computer - Windows 8 or earlier, minimum 256MB ram. (Windows XP with PCMCIA slot if PCMCIA card is being used)

4. Safety Instructions

- Make certain that the gauge ring and the other items in the tool-pack are correctly inserted so as not to obstruct the punch sleeve and ram.
- Never run the bodymaker with a partially filled tool-pack cradle. The gauge rings are made a convenient thickness such that it can replace a part of the normal tool-pack, normally an ironing die. The items in a partially filled tool-pack cradle are not held securely enough and could fall or be knocked into the path of the ram causing a catastrophic crash.
- Great care must be taken when using the gauge ring to make static alignment measurements if the tool-pack cradle is not full and/or the lid is open. Never place fingers in the tool-pack whilst barring or inching the ram.
- Take care with the electrical cables, especially the power cables, which carry mains voltage. The gauge ring cable only has low voltage signals so does not present an electrical safety risk.
- The gauge ring and calibration cradle are heavy pieces of equipment with some sharp edges and corners, so care should be taken with handling and carrying.

5. Installation

1. Insert the CDROM.
2. Run the batch file "Install FSA". (For installing onto a shared drive, copy the fsa.exe, pccgo32.dll and cbw32.dll files to the desired location. Data files can be copied onto the hard drive or a shared drive. Ensure that the location of the database as given in "Options" is set to the correct location).

Steps 3 to 8 are only required if the device drivers need to be installed (i.e. not if loading onto a shared drive).

3. Run the icalsetup.exe from the CDROM. Follow on screen instructions to install the software drivers. (If you have an old model with a PCMCIA card, run pccardgo.exe instead).

4. Connect the data-acquisition interface box using the USB cable. Then run the InstaCal program that will be in the *Measurement Computing* folder in *All Programs* from the Windows Start menu. InstaCal will automatically detect the data-acquisition device and add it to the config file. Note, in *Options* of the FSA program, the hardware should be selected as *USB interface* and the *Board #* should be as shown when InstaCal detected the device (normally zero).
5. Create a shortcut to the fsa.exe file in the C:\Free Stroke Analyser folder and put this on the desktop. Run the fsa.exe file.
6. Click on Setup on the menu bar. If not already done, name the gauge ring by selecting <New Gauge Ring> from the drop down list for 'Gauge Ring' in the Set-Up file. Give a name to identify the Gauge Ring (for example, if you have 2 sizes of gauge ring they could be named 211 and 202).
7. To begin making measurements, the gauge must be calibrated (the Calibration Cradle may also need to be aligned) and a set-up file created. This is covered in the appropriate sections of this manual.
8. Setup the database for storing measurement data files. The location of the database is given in "Options". The default is "C:\Free Stroke Analyser\Data Files" folder, but this can be changed. Define Plants, Lines and Bodymakers in "Database Setup" in the "File" menu. This creates folders in the following form:

Location of Database\Plant name\Line name\Bodymaker name'

6. Connection Instructions



Current (USB) version



PCMCIA card version

- A 12 pin water-tight connector joins the gauge ring cable to the cable that feeds directly into the interface box. The connector comes with caps to

keep it sealed against contamination when disconnected. It is a push-pull connector and to disengage the plug from its cap or the socket, the spring loaded sleeve needs to be pulled back. **DO NOT TRY TO TWIST ANY PART TO DISENGAGE.** Older versions have an 8 pin connector which is not water-tight and should be kept away from possible contamination by coolant, oil, water.

Current (USB) version:

- A USB cable connects the data-acquisition interface box to the computer. The interface box is not water-tight and should be kept dry at all times.

PCMCIA card version:

- The power supply plugs into a mains socket and the jack plug goes into the socket in the interface box. (CAUTION. Don't mix up the power supply for the gauge with the power supply for the computer!)
- A cable connects the interface box to the PC Card. At the PC Card end there is a strain relief attachment that provides some protection to this delicate connection.
- The PC Card fits into the slot on the laptop computer. It may be necessary to insert the card before the computer is switched on for the software to be able to communicate with it. (Note, the computer may have to be rebooted after it has been in a power save or hibernation mode for the card to be recognised).

7. Care and Handling

The Free Stroke Analyser is a piece of precision measuring equipment and should be treated as such to preserve its functionality and accuracy.

- The gauge ring/s and calibration cradle are made from stainless steel or tool steel and have been hardened and tempered. They are therefore fairly tough, but rough treatment could still damage them. In particular, the outside diameter of the gauge ring/s should be kept free of any damage that would prevent it from sitting properly on the wear bars of the bodymaker or calibration cradle.
- The gauge ring/s should under no circumstances be carried or pulled out of the tool-pack by the cable. If the cable is damaged in any way, one or more of the sensors may have to be replaced.

- The sensors in the gauge ring have been positioned precisely and should not be moved.
- In the event that a punch sleeve gets stuck on the spigot of the calibration cradle, it can be freed by using jacking screws in the two holes provided.
- If any part is dropped, it should be sent back to Delta-H Technology for checking and re-calibrating.
- The cables and connectors should at all times be treated gently. Great care has to be taken not to pinch or cut the gauge ring cable when fitting it in the bodymaker, shutting the tool-pack lid and closing the guards. It also has to be fed out of the bodymaker by a route that doesn't interfere with any moving parts when the bodymaker is running. No undue strain or bend should be applied to any of the cables or connectors.
- To clean, simply wipe with a dry clean cloth. A light oil can be applied to the metal parts to protect them from corrosion.

8. Starting the program

To start the program, double-click the Free Stroke Analyser icon from the desktop.



Free Stroke Analyser icon

The Set-up, Calibration and Zero position will all be as they were when the program was last used.

9. Basic step by step procedure







1. Load the appropriate Set-Up File: select from drop down list in the set-up screen. If a new one is required, make the appropriate changes and save by clicking <OK> and entering a name for the new Set-Up File.
2. Ensure that the appropriate 'Gauge Ring', 'Gain Calibrations for Punch Sleeve and Ram', 'Bodymaker Type', 'Gauge Orientation', 'Wear-bar Positions' and AUTO 'Data Capture' mode are selected.
3. If appropriate Gain Calibrations do not exist, create new ones from the calibration screen. The default gain calibrations are only for backup and should not be used if accurate measurements are required.
4. Zero Calibrate the gauge.
5. A static measurement can now be made.

The following is for dynamic measurements only.



6. If not previously reset for the particular Set-Up File, reset the 'Measurement Zone' for the first gauge position where a measurement is to be made. The 'Measurement Zone' for the other gauge position will need to be reset prior to making a measurement there.
7. Make the dynamic measurement.
8. If not previously done for the particular Set-Up, the 'Just Before' and 'In Domer' positions may need to be adjusted. Look at the graphs showing the horizontal and vertical components of the Doming part of the measurement to determine if they are positioned correctly. If not, alter the values for the crank angles that determine these positions in the Set-Up file and select 'Recalculate Dome station Misalignment' from the Tools menu.
9. Save the data file.

10. Menus and Toolbar




 
 



10.1 File menu

<i>Menu command</i>	<i>Toolbar Icon</i>	<i>Description</i>
Open...		Load a dynamic measurement
Left Open...		Load a data file into the Split Screen Display's left side
Right Open...		Load a data file into the Split Screen Display's right side
Save As...		Save a dynamic measurement (see Section 14)
Add/Edit Comments		Add or edit the 'Comments' text that is displayed in the title bar
Database Setup		Setup database for easy saving and loading of data files
Print...		Prints the display. Results can also be pasted into WORD documents by first putting a copy of the display onto the clipboard. To do this, hold <Alt> down and press <PrtScn>
Print Preview		Preview the page to be printed
Print Setup...		Landscape or portrait, paper size, printer
Recent Files		Shortcuts to recently used data files


10.2 Measure menu

<i>Menu command</i>	<i>Toolbar Icon</i>	<i>Description</i>
Dynamic Measurement		Enter the dynamic measurement mode (See Section 13)
Static Measurement		Enter the static measurement mode (See Section 15)

10.3 View Menu

<i>Menu command</i>	<i>Toolbar Icon</i>	<i>Description</i>
Primary Display		View the data from a single data file (See Section 12.1)
Split Screen Display		View and compare data from two data files (See Section 12.2)
First 5 strokes		View the strokes from the start of the measurement
Last 5 strokes		View the strokes from the end of the measurement
First and last 5 strokes		View and compare the average of the first 5 strokes with the average of the last 5 strokes
Forward Stroke		In the Split Screen Display, view the 'Forward Strokes'
Doming		In the Split Screen Display, view the 'Doming' data
Return Stroke		In the Split Screen Display, view the 'Return Strokes'

10.4 Tools menu

<i>Menu command</i>	<i>Toolbar Icon</i>	<i>Description</i>
Expert System		A report of the alignment issues detected (See Section 18)
Re-calculate Dome Station Misalignment		If the 'In Domer' and 'Just Before Domer' positions are adjusted, the dome station misalignment can be re-calculated. (See Sections 12 and 17).
Update displayed 'Markers'		Changes the 'Markers' to those defined in the currently loaded Set-Up file.
Transfer crank angles from displayed data file into Set-up File		Quick method for setting the crank angle setpoints that are used if the Data Capture mode is set to Manual

Calibration, Setup and Options are also accessed directly from the main menu.

11. Options

Units

Metric, units are in microns (0.001mm).

Imperial, units are in thou, which is short for thousandths of an inch (0.001").

Alarm limits

These set the size of the green target zones on the graphs as well as the alarm limits for the appropriate Key Alignment Measures. The target zone for the tool-pack on the return stroke should be set to the clearance between the

punch and the 3rd ironing die (approximately 0.004" or 100 micron), so that any measurement outside of the target zone will indicate that there will be contact causing wear and damage to the tooling.

Markers

Any *Markers* (see Section 12) will not be shown if the check box is ticked.

Zeroing Method

The *On Calibration Cradle* method is the easiest and most accurate method.

The *In Bodymaker* method can sometimes be used if a Calibration Cradle is not available, however this is not possible on some bodymakers because it is necessary to be able to rotate the gauge ring 180 degrees (sometimes the cable prevents this).

The final method, *Calibrate to known alignment reading*, is the fall back method where the static alignment in a given position must be known from some other alignment gauge.

Bodymaker speed

The low speed option is there for special cases where the bodymaker speed is less than around 160cpm. If the *normal* option is selected, the computer memory buffer may overflow at low bodymaker speeds, causing failure.

Hardware option

The program works with a PCMCIA card or a USB interface box. The PCMCIA card was supplied prior to 2011, whilst the USB interface has been supplied since then. If using the USB interface, the Board # must also be specified. This is given when the InstaCal program is run to install the device and will normally be zero unless other boards are also installed.

Location of Data Files

The path specified here is where the program will load and save the static and dynamic measurement files. This can be set to a shared drive location to give site wide access to the data files (although it will need to be kept to a hard drive location on the FSA computer). The data files can then be copied from the FSA computer onto the shared drive. Note, the Database structure should be the same on the shared drive as the FSA computer, i.e. the folder names for plant, lines and bodymakers need to be identical on both.

Wear-bar spacer adjustment


This is only applicable when the *Wear-bar Positions* selected in the Setup File is the first option where the wear-bars are at 45 degrees. The option selected will determine how the Expert System gives the suggested toolpack re-alignment adjustments. The wear-bar spacer thickness can be kept the same on both sides (to avoid any mix up), but this will mean that only vertical adjustment can be made by altering wear-bar spacer thickness. Horizontal adjustment can be made by moving the entire toolpack cradle. If the wear-bar spacer thicknesses are allowed to be different, both vertical and horizontal re-alignment can be made.

12. Data Analysis Screens

The Primary Display is for viewing the data of a single data file. An alternative view, called the Split Screen Display, is used for comparing two data files.

Both views have similar menus and toolbars from which all the functions of the program are called.

12.1 Primary Display

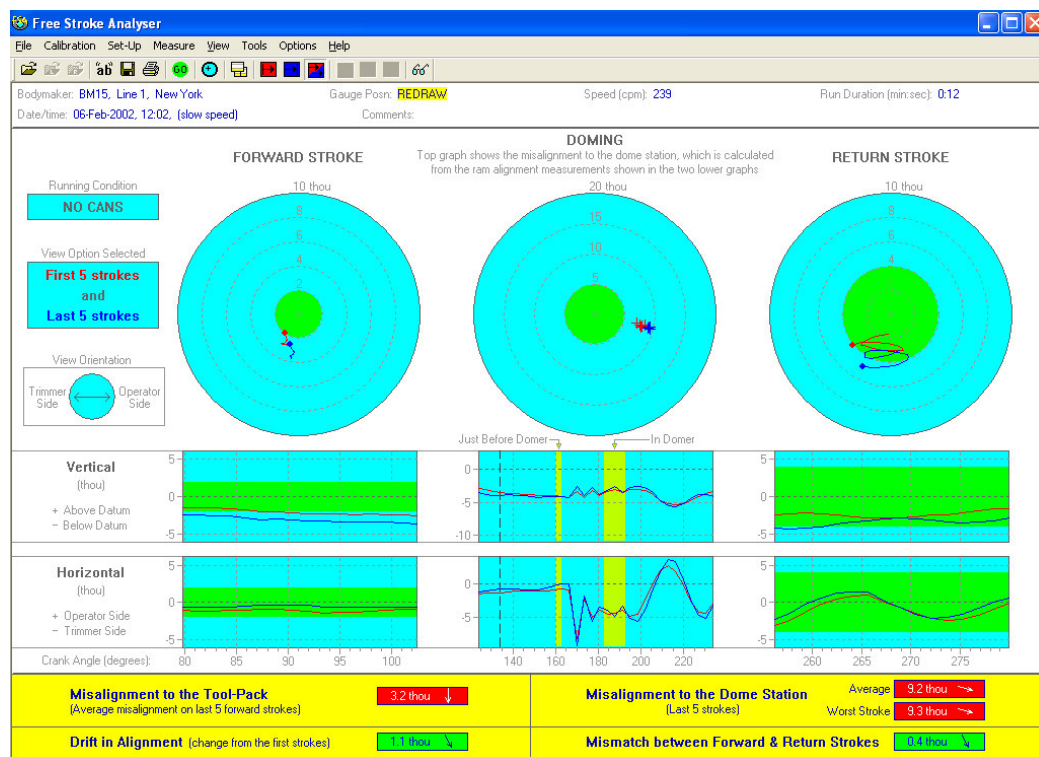

Title Bar

Below the toolbar is a title bar that shows information about the data file:

- Bodymaker (filled in automatically when file is saved)
- Gauge position (eg, 1st iron, 3rd iron)
- Speed of the bodymaker during the measurement
- Run duration (duration between the first measured stroke and the last)
- Date and time the measurement was made
- Comments about the measurement

Display information (on left side of display)

The Running Condition (MAKING CANS or NO CANS), View Option Selected and View Orientation are all given within the graphical area. The View Option Selected can be one of these three options:

- First 5 strokes
- Last 5 strokes
- First and last 5 strokes

The option is selected from the View menu or from the toolbar. When 'First 5 strokes' is selected, the graphs display the data of 5 individual strokes from the start of the measurement. The sequence is indicated by the colours of the 5 letters of 'First' shown in the key, e.g. red is for the first stroke. When 'Last 5 strokes' is selected, the graphs display the data of 5 individual strokes from the end of the measurement. When 'First and last 5 strokes' is selected, a single average trace for each of the first 5 strokes and last 5 strokes is shown. The radial graph showing the 'Misalignment to the Dome Station', however, shows the measurements from the individual strokes irrespective of the View Option selected.

'First 5 strokes' and 'Last 5 strokes' allow the user to see the stroke-to-stroke repeatability, whereas 'First and last 5 strokes' shows the difference between the alignment at the start of running and the steady state condition.

Radial Graphs

The graphical display contains three round radial graphs. They provide a view of the alignment from the dome station end of the bodymaker.

The radial graph on the left shows the alignment of the punch sleeve relative to the centre of the gauge ring (which lies on the centre-line of the tool-pack), as it passes through on the forward stroke. Only this particular portion of the forward stroke is shown. The radial graph on the right shows the same thing except it is for the return stroke part rather than the forward stroke. The radial

graph in the centre shows the misalignment of the punch sleeve to the dome station.

The green area in the centre represents the region where the alignment is within the alarm limits set in “options”. The recommended alarm limits are 0.002” (50 micron) for the tool-pack on the forward stroke, 0.005” (125 micron) for the Doming part of the measurement and 0.004” (100 micron) for the return stroke. The scaling for the graphs is automatic, but the size of the green area always represents the same physical size and therefore gives a visual cue to the scaling. It also represents the region where the alignment is good.

For the Forward and Return Stroke parts of the measurement, the different coloured traces show the position and movement as the punch sleeve passes through the gauge ring. The ends of the traces with the dots are the first points of the measurement. For the Forward Stroke, this should be where the punch nose has just passed through the gauge ring (the punch nose needs to be clear of the sensors to ensure that the measurements are not made in the transition area where errors would be produced). The rest of each trace represents the alignment up to a point where the taper at the end of the punch sleeve is just about to enter the gauge ring. For the Return Stroke it is the reverse, i.e. the ends with the dots are the measurements at the ram end of the punch sleeve. The thin wall, transition and thick wall portions of the punch sleeve are all shown within the trace. In AUTO Data Capture mode (see Section 17), the portions of stroke over which measurements are taken are determined automatically. In MANUAL Mode, they need to be entered manually.

For the radial graph of the ‘DOMING’ part of the measurement, a single measurement point is given for each stroke. This represents the actual misalignment that is calculated from the measurements of ram alignment shown in the 2 graphs below the radial graph.

Graphs of Vertical and Horizontal Components

For the Forward and Return Stroke parts of the measurement, the two rectangular graphs below each of the radial graphs show the same data that is displayed in the radial graph, but in a different way. The vertical and horizontal components of the alignment are shown separately and are plotted against the crank angle position. The values of the two components at the left end of the graphs therefore correspond with the start of the radial graph trace, i.e. the end marked with the dot.

The green bands on the graphs represent the region where the component of the alignment is within the alarm limits. This gives a visual cue to the scaling in the same way as the green area of the radial graph.

The graphs of the vertical and horizontal components located in the centre of the display show the alignment of the ram relative to the gauge ring just before, during and just after doming.

Two small portions of the stroke are highlighted. These correspond with the point just before impact with the domer and the point around bottom dead centre where the punch nose is held in alignment with the domer. They are identified as 'Just Before' and 'In Domer' respectively. The misalignment to the dome station is calculated from the difference between the 'Just Before' and 'In Domer' measurements. This difference is then multiplied by a scaling factor that allows for the fact that the measurements are made at the location of the gauge ring and not actually at the dome station. The scaling factor is automatically calculated by the software and depends on how far the gauge ring is from the dome station.

'Markers' can indicate the positions on the graphs that correspond to particular events, such as when the punch sleeve enters the stripper. There is an option to show or hide the 'Markers' in the view menu. They make it easier to understand what is happening on the graphs and are shown as dark dashed vertical lines at the relevant crank angles and the descriptions are given by placing the mouse pointer over these lines. The position of the 'Markers' is determined by those entered in the Set-Up File that was used when the measurement was made. They can be changed after the measurement has been made by selecting 'Update displayed Markers' from the Tools menu.

Key Alignment Measures

Located at the bottom of the display are the key alignment measures. The magnitude of each is given numerically and an arrow indicates its direction. An alarm status is indicated by the colour of the display box. Green shows it is within acceptable levels, whilst red brings it to the user's attention that it is not. The alarm limits for the tool-pack and dome station misalignment are set in the options menu.

The measures are:

- **Misalignment to the Tool-Pack**

This is given for either the first or the last 5 strokes, depending on the view option. It is the overall average for the 'Forward Stroke' part of the measurement. The arrow gives the direction of the misalignment of the punch sleeve relative to the tool-pack. The direction of the misalignment of the tool-pack relative to the punch sleeve is therefore in the opposite direction.

- **Drift in Alignment (change from the first strokes)**

This is the change in the 'Misalignment to the Tool-Pack' from the first 5 strokes to the last 5 strokes. As the name suggests, this change is generally a slow drift that occurs over the first minute or so of running before stabilising. This is usually the result of uneven frictional heating around the ram where it rubs on the seal-pack or the bushing, or uneven cooling of the ram in the same area. The resultant temperature difference across the ram causes it to bow.

- **Misalignment to the Dome Station**

The measurements are for either the first or the last 5 strokes, depending on the view option. Values are given for both the average and the worst measured stroke.

In some cases, possibly due to ineffective tool-pack clamping which allows the gauge ring to shake, or a loose dome door or dome station, the ram alignment can move a lot during the 'In Domer' portion of stroke. This can result in poor accuracy of the measurement of dome station misalignment. In such cases, a warning is given on the screen.

Technical Note

It should be noted that the dome station misalignment is not measured directly, but is implied from the measurements. Its accuracy cannot therefore be guaranteed. Greater confidence in the accuracy can be had, however, if there is agreement between the readings from both gauge ring positions. If there isn't agreement, the reading from the gauge position that is closer to the dome station is generally the most valid.

In practice, this measure has been found to be very useful. Re-alignments made on the basis of the measure have produced 'Just Before' and 'In Domer' readings that are the same or close, implying no or little misalignment. The process only takes a few minutes, so if some misalignment still remains after the first re-alignment, it can be repeated to get the alignment as close as required.

- **Mismatch between Forward & Return Strokes**

This is the difference in the average alignment of the punch sleeve to the tool-pack between the forward and return strokes. A significant difference indicates a problem with the bodymaker, for example, a blocked lee jet, worn bearings, or a loose component somewhere in the drive mechanism.

Technical Note

Sometimes, vibration on the return stroke caused by dome station misalignment can cause this measure to be higher than if there was no vibration. This is taken into account by the software when it computes the alarm status. i.e. if there is a lot of vibration, the alarm level will automatically be set higher.

12.2 Split Screen Display

The Split Screen Display enables two separate data files to be compared. For instance, they could be the data files for the measurements at the two different gauge positions, or perhaps for the same gauge position before and after some maintenance work. One data file is shown on the left half of the display and the other on the right.

The layout is very similar to the Primary Display (see Section 12.1), but only shows one part of the measurement at one time, i.e. either the forward stroke, doming or return stroke. This selection, as well as the selection of 'First 5 strokes', 'Last 5 strokes' or 'First and last 5 strokes', is made from the view menu or from the toolbar. The scaling of the graphs is automatic, and will always be the same on one half of the display as the other, so that direct comparisons can be made.

13. Dynamic Measurement

13.1 Dynamic measurement in free stroking mode, i.e. not making cans

To make a comprehensive check of the alignment of a bodymaker, dynamic measurements need to be made with the gauge ring placed at or near the two ends of the tool-pack. (For Ragsdale bodymakers with the letterbox type tool-pack, it is necessary to make measurements with the gauge ring placed in each letterbox slot, although not necessarily dynamic measurements in them all). The two gauge positions are set-up in the Set-Up file (if more than two are required, as with the letterbox style tool-pack for example, more than one Set-Up file will need to be created). To make a measurement, the bodymaker is run in continuous mode under the same conditions as in normal production, except with no cups being fed in. Some production bodymakers cannot be run like this, without making a change to the electrical control circuit or the program. In such cases, a key switch, wired in such a way as to enable this mode of running, should be added to the control panel or inside the control cabinet. The coolant flow should be on during the run as it can have a significant effect on the alignment, particularly the 'drift' (described in Section 12.1). However, the measurements can be compared with those made with the coolant flow turned off, to see the effect.

The two gauge positions do not need to be at the very ends of the tool-pack, but somewhere close is advisable. Convenient gauge positions are the 1st and 3rd ironing die positions, where the gauge ring (assuming it is the thickness of

a single die) can simply replace those dies without the need to move anything else. Older gauge rings were made the thickness of two ironing dies. To enable them to fit in the tool-pack, two dies (or a combination of dies and guide rings) need to be removed and the remaining dies and coolant spacers moved and the gauge ring placed in at the desired position. If the coolant is fed into the tool-pack via ports in the tool-pack lid that line up with the inlet ports in the coolant spacers, make sure that at least two of these line up. Once these positions have been settled upon, a note should be kept of them so that the same positions are used for all future measurements. The same Set-Up File can then be used each time a measurement is made on that bodymaker type and set-up.

The dies and guide rings should have sufficient clearance around the punch sleeve so as not to interfere with the stroke; 0.010" (250 micron) clearance is usually sufficient. It is therefore advisable that the dies that remain in the tool-pack are replaced with dummy rings. This has the added advantage that the dies cannot be damaged during the measurement by impacts from the punch. If ironing dies are left in the tool-pack and the misalignment is large enough to cause the punch to hit them, then the measurement will show that the misalignment is less than it would otherwise be.

The gauge ring should be used in the correct orientation. There are 4 different orientations that can be used. Different types of bodymaker will require the gauge ring to be used in different orientations in order that the cable can be fed out of the cradle. The orientation to be used needs to be selected in the 'Setup File'. The gauge ring is etched with the sensor numbers and some older gauge rings also are etched with the word 'TOP' on the rim to aid correct orientation. The gauge ring can be oriented so that the cable comes out on either side. Great care should be taken with the gauge ring when putting it in and taking it out of the tool-pack, and when closing the tool-pack lid to avoid knocks, scratches and damage to the cable. See Section 7 for guidance on care and handling.

Prior to starting the measurement, make sure the correct Set-Up File is selected. The name of the currently selected file is given at the top of the Dynamic Measurement display. If necessary, create a new Set-Up File by editing an existing one. The same Set-Up File can be used for measurements on the same bodymaker type, with the same punch sleeve type and the same gauge ring positioning within the tool-pack. The gauge ring should be Zero Calibrated prior to making measurements. See Sections 16 and 17 for more detailed information about calibration and set-up. (Note, some parts of the measurement, for example dome station misalignment and drift, will still be correct even if the gauge is not Zero Calibrated. This is because they are relative measurements, i.e. the difference between two measurements).

Each measurement will typically be of about 1 minute of running, starting with the first stroke of a run and stopping when a steady state condition has been reached. The steady state condition is reached when the traces that are displayed in the on-line display stop drifting away from the position of the

previous traces. Before starting the measurement, it is advisable to have a period of at least 2 minutes in which the bodymaker is not run. This will allow temperature differences that develop across the ram during running to stabilise, and enable any 'drift' in alignment, to be picked up by the measurement.

If AUTO is selected in the Data Capture section of the Setup File, the gauge position (for example 1st or 3rd die) will be automatically determined. This is done after the first 2 strokes and will be shown at the top of the display. In some situations the software can make an error and get the gauge position wrong. If this happens, abort the measurement and start the measurement again. If it keeps happening, try starting the measurement just after the first stroke. i.e. start the bodymaker running first before starting the measurement, or Reset the Measurement Zone, or temporarily disable the other gauge position in the Set-Up file.

During a dynamic measurement, the Free Stroke Analyser measures approximately every other stroke depending on bodymaker speed, displaying a selected part of the results in real-time. The graphical display is a radial graph; see Section 12.1 for an explanation. Each stroke is shown as a different coloured trace and after every ten strokes the display is wiped clear. The scale is set automatically and will change during the run if the readings exceed the full scale. The full set of results can be analysed when the measurement is completed and the program returns to the Primary Display.

Three separate portions of the stroke are measured:

- Punch sleeve passing through gauge ring on forward stroke
- Punch sleeve passing through gauge ring on return stroke
- The portion of the stroke where the ram is passing through the gauge ring before, during and after doming. This will be referred to as 'Doming'.

Only the first of these is displayed in real-time during the measurement.

The 'Doming' portion of the stroke is longer for gauge positions further away from the dome station. This is because the gauge ring 'sees' the ram for a larger portion of the stroke. On some bodymakers, the gauge position nearest the dome station may be such that the gauge ring only 'sees' the ram for a very short time, or not at all. If this is the case, the dome station misalignment will not be measured in that gauge position. It may be possible to move the gauge position back a little so that more of the ram is seen by the gauge.

13.2 Dynamic measurement when making cans

The Free Stroke Analyser has primarily been designed as a tool for measuring the alignment when not making cans. The reason for this is that when making cans, the dies pull the punch sleeve off its natural path. It is desirable to measure the natural path because this is what the dies should ideally be aligned to. To measure this natural path, it is therefore necessary to run the bodymaker in the free-stroking mode. It is also possible, however, to obtain measurements whilst making cans. Such measurements can provide useful extra information.

Interpretation of the results is not as straightforward as is the case for when running without making cans, at least for the forward stroke part of the measurement. This is because the forward stroke part of the measurement may include the portion of the stroke when the sensors are reading off the can wall as well as the portion when they are reading off of the punch sleeve directly. Also, the transition between these two will produce measurements that have to be disregarded. The measurements made when the sensors are reading off the can wall will not be calibrated, so these measurements can only be used as a guide. The doming and return stroke parts of the measurement, however, are not affected by the can and so are equally as valid whether making cans or not. Some of the 'Key Alignment Measures' at the bottom of the Analysis display are not given if the measurement was made whilst making cans. This is because they can only be determined when not making cans.

The gauge ring can be placed anywhere in the tool-pack where a gap can be made for it. It may be necessary to make a special coolant spacer or to modify an existing one in order to make room for the gauge ring.

The Set-Up File should have the 'Making Cans' tick box selected and it is also necessary to select MANUAL in the Data Capture section. It may also be useful to adjust the crank angle set points that determine the portion of stroke over which the measurement is made for the forward stroke part of the measurement. Increasing the range can help to work out what is going on, whilst reducing the range will enable greater detail to be obtained at a particular point in the stroke. Also, it may be necessary to start the dynamic measurement after the bodymaker has started. This is because the cup feed does not start for the first one or two strokes on some bodymakers.

14. Saving and Loading

To keep a record of dynamic measurements they should be saved. When saving, the window shown below will be displayed.

The screenshot shows a 'Save' dialog box with a blue title bar. Inside, there's a section titled 'Automated Save' with several input fields: 'Plant' (New York), 'Line' (Line 1), 'Bodymaker' (BM15), 'Date' (23 May 2007), 'Gauge Position' (1st IRON), 'Making Cans' (checkbox), and 'Additional info' (text box). To the right of these fields are three buttons: 'OK', 'Cancel', and 'Help'. Below the 'Automated Save' section is a 'Manual Save' section with a text box containing the message 'File must be given a name and can be saved to any location' and a 'Manual Save' button.

The 'Automated Save' facility simplifies the process of saving and loading. Simply select the appropriate plant, line and bodymaker, then click <OK>. Some text can be typed into the Additional Info box to help to identify the measurement, but this is not necessary unless more than one measurement needs to be saved at the given gauge position on a single day. Having saved the file, the plant, line and bodymaker will be shown in the title bar when the measurement is displayed.

For the plant, lines, and bodymakers to appear in the window shown above it is necessary that the database has been setup. The database is located in a folder specified in "Options". This is initially set to "C:\Free Stroke Analyser\Data Files", but can be changed. Use the "Database Setup" function in the "File" menu to add plants, lines and bodymakers. This creates separate folders for the bodymakers in which the data files will be stored. The database can also be setup using Windows Explorer, and this will be necessary if plants, lines or bodymakers need to be changed or deleted.

<Manual Save> can also be used to save measurements. Files need then to be given a filename and can be saved in a location of the user's choice. When loading a saved measurement, the following window will be displayed.

Plant: New York

Line: Line 1

Bodymaker: BM15


Files	DATE	POSITION	ADDITIONAL INFO
making cans	20 Aug 2008	1st IRON	
	20 Aug 2008	1st IRON	
	20 Sep 2007	1st IRON	
	23 May 2007	3rd IRON	
	23 May 2007	1st IRON	
making cans	23 May 2007	1st IRON	
	06 Feb 2002	REDRAW	high speed
	12 Feb 2004	REDRAW	
	12 Feb 2004	FINAL DIE	
	12 Feb 2004	REDRAW	Dome aligned
making cans	06 Feb 2002	REDRAW	

OK Cancel Browse

Simply select the appropriate plant, line and bodymaker to bring up a list of all the saved dynamic measurements on that bodymaker. The measurements will be sorted by date, the most recent at the top. Select the required measurement and click <OK> (or double click on the measurement). Note, the 'POSTION' field will be empty for files that have not been saved using the 'automated save' facility and the full filename will be given under 'ADDITIONAL INFO'.

<Browse> can be used to search for measurements manually. This will be necessary if they are not in the database at the location specified in "Options".


15. Static Measurement

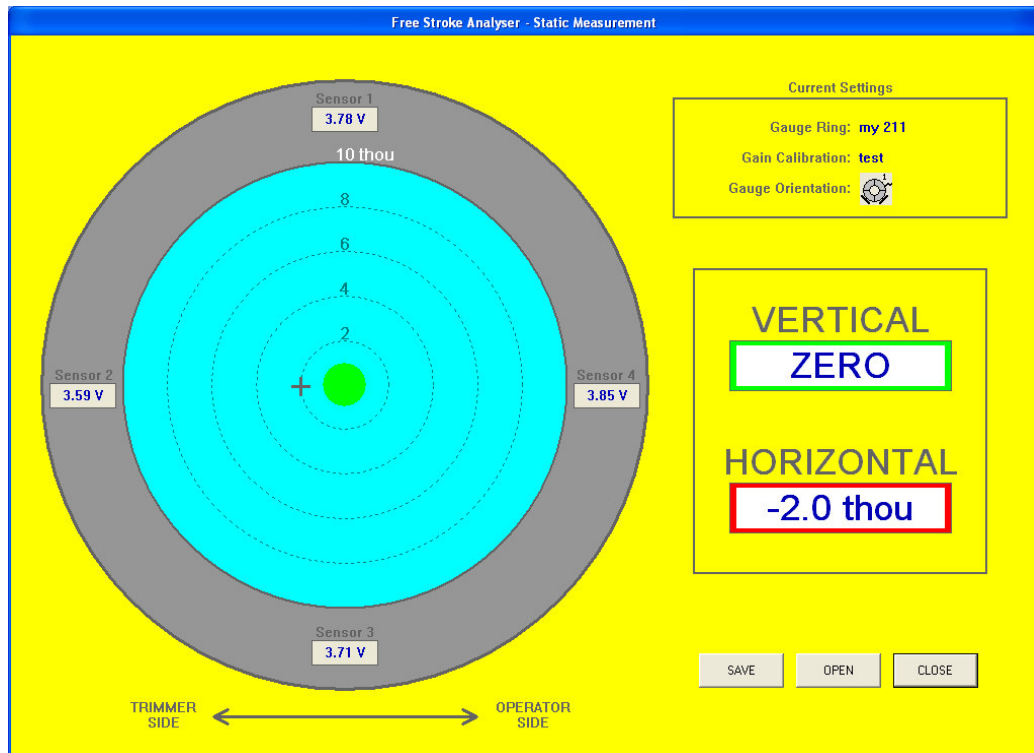

The Static Alignment Display, as shown above, provides a real-time measurement of the alignment of the punch sleeve or ram relative to the centre of the gauge ring. Provided the alignment is within 0.010" (250 micron), it is shown as a cross on the display. Otherwise, an arrow indicating the direction of the misalignment is shown within the display. The measurement is also shown numerically, given in the form of a vertical and a horizontal component. The green circle at the centre of the graph is the target area, the size being that of the alarm limit which is set in the options menu. Similarly, the numerical readings will be bordered in red if they are larger than the alarm limit or green if they are lower.

It should be ensured that the correct Set-Up file is selected (only the 'Gauge Ring', 'Gauge Orientation', 'Wear-bar Positions' and 'Gain Calibration for Punch Sleeve' elements of the Set-Up file are used for static measurements), and also that the gauge ring has been Zero Calibrated. To make static measurements, place the gauge ring in the tool-pack cradle at any desired position, making sure it is correctly orientated - see Section 13. Bar the bodymaker over so that the gauge ring is over a parallel length of the punch sleeve. The parallel length must extend at least 10mm either side of the gauge ring for an accurate reading to be obtained. (The mid/top wall transition on the punch sleeve does not adversely affect the accuracy and so can be considered as parallel).

The static measurement can be saved by clicking <Save>. The window shown below will be displayed.

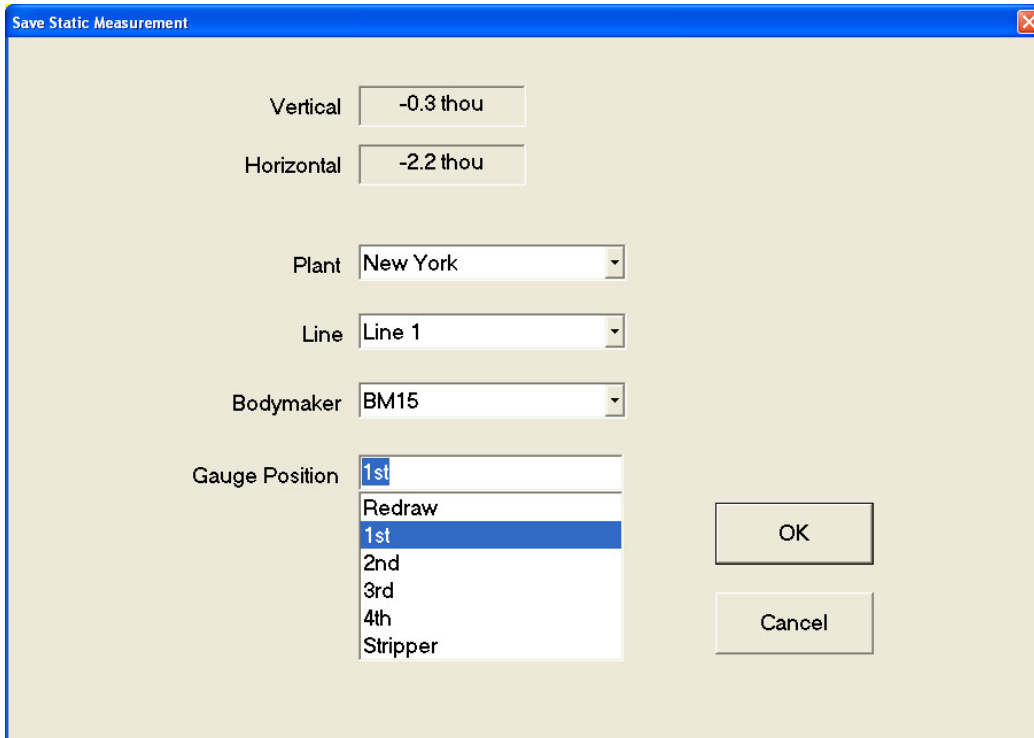

The image shows a software dialog box titled "Save Static Measurement". It contains several input fields and a list box. The "Vertical" field is set to "-0.3 thou" and the "Horizontal" field is set to "-2.2 thou". The "Plant" dropdown menu is set to "New York", the "Line" dropdown menu is set to "Line 1", and the "Bodymaker" dropdown menu is set to "BM15". The "Gauge Position" list box is open, showing options: "1st", "Redraw", "1st" (highlighted), "2nd", "3rd", "4th", and "Stripper". At the bottom right of the dialog are "OK" and "Cancel" buttons.


The appropriate plant, line, bodymaker and gauge position should be selected prior to clicking <OK>.

For the plant, lines, and bodymakers to appear in the window shown above it is necessary that the database has been setup. See Section 14, Saving and Loading.

Static measurements from different gauge positions on the same bodymaker on the same day are saved in the same file so that they are all shown together when the file is loaded. An example is shown in the figure on the next page. If more than one static measurement is saved for a given gauge position on a given day, the user is given the option of either replacing the measurement or creating a new one. If a new one is created, the old measurement is saved with a suffix after the date, e.g. '18 Feb 2010 (1)'. If a file already exists with the suffix '1', it will be saved with the suffix '2' instead, and so on. The latest measurement will always be the one with no suffix.



16. Calibration

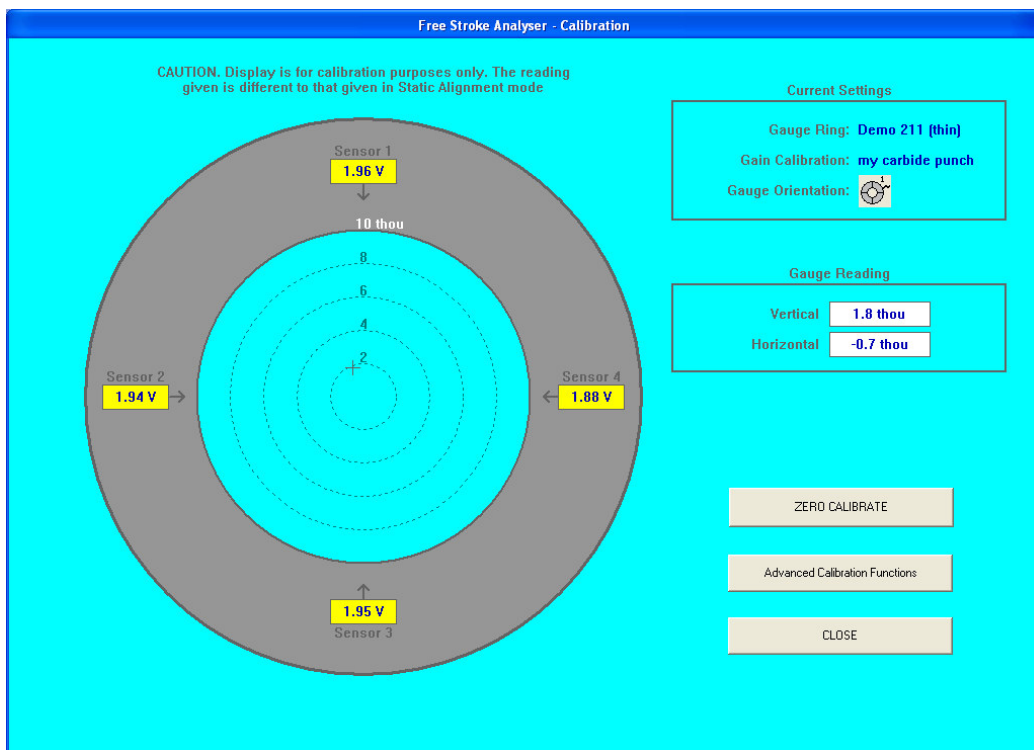

The Calibration Display is similar to the Static Alignment Display. It has the same real-time graphical representation of the measurement. The measurement given, however, will not necessarily be the same as is obtained in the Static Alignment Display. This is because two compensation factors have to be applied to the reading that is shown in the Calibration Display to get the correct Static reading. The compensations are for the misalignment of the calibration cradle (if Zeroing method selected is 'On Calibration Cradle') and for the gauge ring diameter.

In addition to the alignment reading, the display also gives the actual output of the four sensors. These are only required for diagnostic purposes. The full output range is 0 to 10 Volts, and the linear operating range is 1 to 9 Volts. They should all give approximately the same reading when the gauge ring is on the calibration cradle with a punch sleeve fitted.

There are two parts to the calibration; the gain and the zero:

The 'gain' is the sensitivity of the sensors to a change in distance from the punch or ram. The gain depends on the material of the object being measured. Gains are saved to file and each one is given a different descriptive name. The gain that is used to obtain the measurements shown in the Calibration screen is the one that is selected in the 'Gain Calibration for Punch Sleeve' in the currently loaded Set-Up File. The correct orientation of the gauge is also dependent on the setting in the Set-Up File. It is therefore important that an appropriate Set-Up file is loaded before using the Calibration Display.

The 'zero' is the alignment of the punch sleeve within the gauge ring is reading zero. This needs to be set so that a zero is obtained when the punch sleeve is exactly in the centre.

ZERO CALIBRATE

The purpose of the Zero Calibration is to ensure that a Zero reading is obtained when the punch sleeve is exactly aligned with the tool-pack. The gauge should be Zero Calibrated every day the Free Stroke Analyser is used. The gauge ring should be oriented as indicated by the diagram in the 'Current Settings' section of the display. Note, this may be different than 'gauge orientation' selected in the setup file.

Zero Calibration is done in one of three ways depending on the option selected in 'Zeroing Method' from the Options menu:

'On Calibration Cradle' should be selected if a Calibration Cradle is available. This is the simplest method.

'In Bodymaker' should be selected if a Calibration Cradle is not available, however this is not possible on some bodymakers because it is necessary to

be able to rotate the gauge ring 180 degrees (sometimes the cable prevents this).

'Calibrate to known alignment reading' can be selected if neither of the other two methods is possible. For this method the static alignment must be known (i.e. has been obtained from another alignment gauge). The Free Stroke Analyser is calibrated to give the same reading. This method is reliant on the accuracy of the other alignment gauge.

It is not usually necessary to Zero Calibrate with the same punch sleeve that is in the bodymaker, although you should use one of the same type (small diameter differences of punch sleeves within the tooling range will not effect the Zero). There may be a difference between the readings obtained on different punch sleeves, but it will normally be too small to worry about. There is normally a small amount of error caused by material, surface finish or magnetism variation around the punch sleeve. This can be seen by the variation in reading obtained as the punch sleeve is rotated on the Calibration Cradle. If the variation in reading obtained on your punch sleeves is generally larger than about ± 0.0005 " (12.5 micron), then you should consider using the gauge only with a special punch sleeve where this error is known to be small. Alternatively, the "Special Zero Calibration" could be used to increase accuracy (see next section). This method can also be used to give a guaranteed accurate Zero Calibration.

It should be ensured that the correct Gain Calibration is loaded before Zero Calibrating.

The gauge ring should be at the temperature of the tool-pack to maximise accuracy. The effect of temperature should be small, however. The error in reading caused by zeroing the gauge at room temperature will generally be around 0.5 thou (12.5 micron).

ZERO CALIBRATE: On Calibration Cradle

There are two kinds of Calibration Cradle. One kind is designed to hold the punch sleeve in the same way it fits on the ram, i.e. on a spigot with a close fit. In the alternative design, referred to as the V-block style calibrator, the punch sleeve sits within a V-block. When using the V-block style calibrator, the punch sleeve should sit squarely on the midwall section. With some punch sleeves it may be necessary to weigh down the punch nose end to hold them down squarely and to prevent them tipping up onto the thickwall section.

The calibration cradle has been built to hold a punch sleeve in the centre of the gauge ring (see Section 16.1 about how to align the calibration cradle). If you have a V-block style calibrator, a punch sleeve from the middle of the tooling range should sit in the centre of the gauge ring. There may be a small misalignment of the calibration cradle, but this is compensated for in the software (for the V-block style calibrator, this misalignment will be dependent

on the punch sleeve diameter, larger diameter punch sleeves will sit a little high and lower diameter ones will sit a little low). The reading that is obtained when the gauge is placed on the calibration cradle should be zero (for the V-block style calibrator, this is only true if the punch sleeve being used is the same as was used for the last Zero calibration). If the reading obtained is not zero, the gauge needs to be Zero Calibrated by clicking the 'ZERO CALIBRATE' button. The full calibration procedure will then be displayed on the screen. As part of the zero calibration, the misalignment of the calibration cradle is checked and compensated for.

The reading obtained with the gauge ring on the calibration cradle will depend to a degree on the orientation of the punch sleeve. This is because of material non-homogeneity, magnetised areas or wear. The variation in reading obtained as the punch sleeve is rotated is usually only 0.0002" or 0.0003" (5 to 7 micron). To average out any variation and thus to minimise errors, the punch sleeve should be continuously rotated during the process of Zero Calibrating (approximately 20 seconds).

There is also a 'Special Zero Calibration' button in the 'Advanced Calibration functions'. This function can be used to give a more precise Zero and should be used if the variation in reading obtained as the punch sleeve is rotated is high (above about 0.001" or 25 micron). A precise Zero will be obtained at one particular orientation of the punch sleeve (mark the top to identify this orientation). To make alignment measurements, the same punch sleeve will need to be put in the bodymaker, using the mark to orient it the same way up.

ZERO CALIBRATE: In Bodymaker

The punch sleeve should be loosened on the ram spigot so that it can be freely rotated. Remove all the dies and coolant spacers from the tool-pack cradle and place the gauge ring somewhere in the middle of the cradle. Bar or inch the ram forward until the punch sleeve is within the gauge. Select ZERO CALIBRATE and following the instructions that appear on the screen, take a measurement and continuously spin the punch sleeve on the spigot while the measurement is in progress (approximately 20 seconds). The gauge ring then has to be rotated 180° about its axis and a measurement taken again (this may not be possible on some bodymakers, in which case it will not be possible to Zero Calibrate with this method). Remember to retighten the punch sleeve on completing the Zero Calibration.

ZERO CALIBRATE: 'Calibrate to known alignment reading'

The static alignment of the punch sleeve first needs to be obtained by using another alignment gauge. Having obtained the alignment reading, place the Free Stroke Analyser gauge ring at the same position on the punch sleeve. Select ZERO CALIBRATE and, following the instructions on the screen, enter the known alignment reading.

CALIBRATE GAIN

The gain settings for different punch sleeve types and rams are held in separate Gain Calibration files. They only need to be calibrated once (use any punch sleeve from the line) as they will not change over time. i.e. they do not need recalibrating (unlike the zero). The pre-installed default gain calibrations for punch sleeve and ram will also give reasonably accurate results

The gain for a punch sleeve can be calibrated either on the Calibration Cradle or in the bodymaker. For a ram, it can only be done in the bodymaker. To calculate the gain it is necessary to move the gauge ring by a known amount and to measure the change in the alignment reading. After selecting CALIBRATE GAIN, the instructions on the screen will first ask for some feeler stock to be placed between the gauge and one of the wear bars. A measurement is then taken. When taking these measurements the gauge ring should be held down, if necessary, to ensure it is sitting squarely. To move the gauge ring a known amount, the feeler stock is removed. A measurement is then taken again. The gain is calculated and saved with a name given by the user. If desired, the new Gain Calibration can be loaded directly into the currently loaded Set-Up file. Alternatively, it can be loaded into Set-Up files afterwards.

It is a good idea to check the Gain Calibration immediately after creating it. This is easily done by again placing feeler stock between the gauge and one wear bar and checking that the change in reading corresponds to the thickness of the feeler stock.

Technical Note

Gain Calibration files (or Set-Up files) cannot be deleted or renamed from within the program. They are located in the C:\Free Stroke Analyser\Calibration Files\Gauge Name' folder (or C:\Free Stroke Analyser\Set-Up Files folder) and can be deleted or renamed in the normal way. Do not change the file extension (.CAL for Calibration Files and .STP for Set-Up Files), however, or the program won't read them. Renamed Calibration Files will have to be re-selected in any Set-Up Files where they are needed.

16.1 Calibration Cradle Alignment

Normally the calibration cradle would have been supplied already aligned (note, the V-block style calibrator does not require any alignment). However, in some cases it may need aligning prior to use. To check, do step 11 of the procedure given below. If either of the new "compensation" amounts are more than about 1 thou (25 micron), it should be re-aligned by following the procedure below (if the misalignment is less than around 10 thou you can start the procedure at step 12). Having been set, it shouldn't need re-setting unless it is roughly treated. Note, Zero Calibration of the gauge will be accurate as long as the Calibration Cradle alignment is within about 5 thou (125 micron), because the software takes this misalignment into account as part of the Zero Calibration procedure.

The procedure for aligning the Calibration Cradle is as follows:

1. Fit a punch sleeve onto the Calibration Cradle.
2. Start up the FSA software.
3. Go to the Set-Up page.
4. Under "Gauge Ring", select as appropriate. If the gauge ring is new, select "new gauge ring". This will setup the new gauge ring. Enter a name, e.g. "New York 211". For the actual and nominal diameters, enter the same for both (different values only need to be entered if the gauge ring is not within spec).
5. Select OK on the setup page and save the setup file with a new name, e.g. "Line 2".
6. Go to the Calibration Page.
7. Fit the gauge ring on the Calibration Cradle, making sure the gauge orientation is as shown by the small picture on the screen.
8. Observe the voltage readings of the sensors. If they are all within about 0.5V ignore steps 9 and 10 and go straight to 11.
9. Loosen the two large cap head screws on the back of the Calibration Cradle. Nip them up just enough so that the position of back plate can be moved slightly by tapping with a soft hammer (this is only the coarse adjustment to get it reasonably close before doing the fine adjustment).
10. Adjust the position of the back plate by tapping with a soft hammer. Move it so that the voltage readings are all within about 0.5V (normally, this will be achieved when the cross is near the centre of the graph) when the cap head screws are retightened. Tighten the 2 screws as tight as possible using a pipe extension on the allen key (however, do not clamp the Calibration Cradle in a vice when tightening the screws, it is sufficient to just hold it down).
11. Carry out a Zero Calibration. Select Zero Calibrate. The final screen before finishing the calibration procedure shows what the misalignment of the calibration cradle is. If the new values are both less than about 1 thou (25 micron) then it is close enough and you can skip to step 14.
12. After finishing the Zero Calibration (select "Finish") go to the "Static Measurement" page. The spigot needs to be moved so that the alignment reading is zero (remember to return the gauge ring to the correct orientation). To move the spigot, loosen off the 6 cap head screws (or 3 on older units) holding it onto the back plate. Nip them up loosely so that the spigot position can be adjusted using the 3 set screws.
13. Repeat step 11 to check that the alignment is within about a thou (25 microns). It should be possible without too much difficulty to get the alignment within 0.3 thou (10 microns). Any misalignment will be compensated for by the software, so it is not strictly necessary to get it closer than about 5 thou (125 microns).

14. Select “Finish” at the end of the Zero Calibration to complete the calibration and apply the compensation that is required for any misalignment of the calibration cradle.

17. Set-up

The screenshot shows the 'Set-Up' window with the following sections:

- SET-UP FILE NAME:** A dropdown menu showing 'Line 1'. To the right, text reads: 'To load a different Set-Up file, select it from the drop down list. To save changes made to a Set-Up file, select <OK>. The existing file can be replaced or a new one created by giving it a new name.'
- SET-UP FILE:** A section with 'Gauge Ring' (dropdown: 'my 211'), 'Gain Calibration for Punch Sleeve' (dropdown: 'Default Punch'), 'Gain Calibration for Ram' (dropdown: 'Default Ram'), 'Bodymaker Type' (dropdown: 'CMB Engineering or Standun'), 'Gauge Orientation' (four circular icons), 'Data Capture' (radio buttons: 'Auto' selected, 'Manual'), 'Advanced' button, 'Making Cans' checkbox, and 'Markers' Set-Up' button.
- Dome Station Misalignment:** 'Start of 'JUST BEFORE DOMER' measurement (crank angle degrees)' (input: 160), 'Start of 'IN DOMER' measurement' (input: 184), 'Scaling factor to allow for flexibility of the domer support structure. There is normally little or no flexibility for which the setting should be 1.' (input: 1), and 'Disable measurement' checkbox.
- GAUGE POSITION 1:** 'Name for this Gauge Position' (input: '1st IRON'), 'Enabled' checkbox (checked), 'Crank Angle (degrees)' (input: 73 to 287), 'Measurement Zone' (input: 73 to 287), 'To reset, run the bodymaker for a few seconds then press this <Reset> button.' (Reset button), 'Offset applied to Measurement Zone' (input: 0), 'Start of 'FORWARD STROKE' measurement (on punch sleeve)' (input: 79), 'End of 'FORWARD STROKE' measurement (on punch sleeve)' (input: 103), 'Measure 'DOMING' part of stroke (the ram must enter the gauge)' checkbox (checked), 'Start of 'DOMING' measurement (on ram)' (input: 124), 'End of 'DOMING' measurement (on ram)' (input: 244), 'Start of 'RETURN STROKE' measurement (on punch sleeve)' (input: 265), 'End of 'RETURN STROKE' measurement (on punch sleeve)' (input: 289).
- GAUGE POSITION 2:** 'Name for this Gauge Position' (input: '3rd IRON'), 'Enabled' checkbox (checked), 'Crank Angle (degrees)' (input: 104 to 256), 'Measurement Zone' (input: 104 to 256), 'To reset, run the bodymaker for a few seconds then press this <Reset> button.' (Reset button), 'Offset applied to Measurement Zone' (input: 0), 'Start of 'FORWARD STROKE' measurement (on punch sleeve)' (input: 116), 'End of 'FORWARD STROKE' measurement (on punch sleeve)' (input: 139), 'Measure 'DOMING' part of stroke (the ram must enter the gauge)' checkbox (checked), 'Start of 'DOMING' measurement (on ram)' (input: 160), 'End of 'DOMING' measurement (on ram)' (input: 208), 'Start of 'RETURN STROKE' measurement (on punch sleeve)' (input: 229), 'End of 'RETURN STROKE' measurement (on punch sleeve)' (input: 252).

To make alignment measurements, certain information is required by the program. This set-up information is saved in a file that can be recalled whenever needed. The file contains the set-up for both gauge ring positions. The same Set-Up file can be used for bodymakers of the same type and set-up. The Set-Up File is selected from the drop down list at the top of the Set-Up window.

Gauge Ring

If there is more than one gauge ring in use with the equipment (e.g. a plant may produce two sizes of can diameter and have a gauge ring for each), the name given for the gauge to be used is selected here. A separate Zero Calibration is saved for each gauge ring. When switching between gauge rings, the Zero Calibration will be reset to the same as it was the last time that

gauge ring was used. Each gauge ring should be Zero Calibrated before it is used on any given day, but it is not necessary to recalibrate when switching back to a gauge ring that has already been Zero Calibrated.

To add a new gauge ring, select <New Gauge Ring> from the drop down list. Give it an appropriate name to distinguish it from any other gauge rings.

Gain Calibration for Punch Sleeve

Select the appropriate file from the drop down list. The files contain the gain settings for different punch sleeves and rams. Note, only the Calibration Files for the particular gauge ring that is selected in the 'Gauge Ring' drop down list are shown. To create a new Gain Calibration see Section 16.

Gain Calibration for Ram

The Gain Calibration for the ram as well as the punch sleeve is required because the gauge measures the alignment of both during dynamic measurements. Select the appropriate Gain Calibration from the drop down list. To create a new Gain Calibration see Section 16.

Bodymaker Type

This setting ensures that the Expert System gives the appropriate advice. There are 4 options:

- CarnaudMetalbox Engineering / Standun
- Ragsdale (Tool-pack style)
- Ragsdale (Letterbox style)
- Vertical Bodymaker (this option changes the dynamic and static measurement displays to suit the vertical orientation and also disables the *Gauge Orientation* and *Wear-bar Position* setup options)

Gauge Orientation

The gauge can be placed in the tool-pack in 4 different orientations. Choose the one which enables the cable to be fed out of the tool-pack for the particular bodymaker being measured. The number of the sensor which needs to be pointing vertically upwards is given by the number in the little diagram. Note, that when sensor 2 or 4 is selected to be at the top, Calibration is done using a different orientation (as indicated by the diagram on the Calibration page). This is so that the cable doesn't need to go underneath the Calibration Cradle.

Wear-bar Positions

This refers to the location of the wear-bars (rails) on which the ironing dies sit. There are 3 options:



Wear-bars each at 45°



Wear-bars close to horizontal underneath and close to vertical on the side. These are the positions for the CarnaudMetalbox side entry tool-pack cradle design



Wear-bars at 15° to horizontal and vertical (tool-pack angled at 30° to vertical)

Data Capture

This refers to the way the dynamic measurement works. For normal measurements of dynamic alignment, AUTO should be selected. In this mode the program automatically determines the start and end points of the three parts of the measurement ('Forward Stroke', 'Doming', 'Return Stroke') as well as the gauge position. Refer to the section about the Measurement Zone if the program makes an error in determining the gauge position.

MANUAL mode is usually only needed in the event that AUTO mode doesn't function properly or measurements are being made whilst making cans. The set-up for a MANUAL mode measurement requires additional information, specifically the start and end points of the three parts of the measurement. The fields where this information can be entered are greyed out, as they are not required, when AUTO mode is selected.

The crank angle values that specify the start and end points of the 'Forward Stroke', 'Doming' and 'Return Stroke' parts of the measurement in MANUAL mode should be set to span regions where the readings are accurate, i.e. where the punch sleeve and ram have uniform sections, away from the punch nose, punch taper, spacer or the end of the ram. The uniform section should extend at least 10mm either side of the gauge ring at these crank angles. These values can be obtained from the encoder reading after the bodymaker has been barred or inched to the desired positions. Alternatively, the 'Tools' menu has a function that transfers the crank angles of the start and end points of the 3 parts of the currently displayed measurement into the currently loaded Set-Up File. This can be used if a successful measurement has already been made in AUTO mode with the same bodymaker type and set-up.

Advanced

There are two advanced options.

The first option can be selected if it is found that the doming part of the measurement is not captured when the gauge ring is in the 3rd die position. Checking the tick box will force the doming part of the measurement to be made, but some care should be taken to ensure the readings are sensible because the measurement may take place over the end of the ram where measurement error is possible.

The other option is for the very rare situation where punch and ram are in range of the sensors, but the signal goes out of range (signal greater than about 9.7V) on the taper on the end of the punch (or punch sleeve spacer).

Making Cans

Tick this box if measurements are to be made whilst making cans. An incorrect setting will mean that the measurement will not be displayed properly and the Expert System Report will not be appropriate.

'Markers' Set-Up

'Markers' can indicate the positions on the graphs that correspond to particular events, such as when the punch sleeve enters the stripper. They make it easier to understand what is happening on the graphs and are shown as dark dashed vertical lines at the relevant crank angles. The option to show or hide them can be found in the view menu. The position of the 'Markers' is determined by those entered in the Set-Up File that was used when the measurement was made. They can be changed after the measurement has been made by selecting 'Update Displayed Markers' from the Tools menu.

The crank angles at which the events occur and their descriptions are entered by the user. Up to 16 different 'Markers' can be entered and they can be edited and deleted.

Dome Station Misalignment

The positions of the 'Just Before Domer' and 'In Domer' portions of the stroke, which are explained in Section 12.1, are given by the crank angle values in the two boxes. As a starting point, they should be set to 164 for the 'Just Before Domer' position and 182 for the 'In Domer' position. These will be approximately correct and final tweaking can be made after a measurement has been made.

The 'Just Before Domer' position should occur just before the punch nose makes contact with the dome station tooling. This first contact usually causes a sudden change in the alignment, and so can clearly be identified on the graphs. The 'Just Before Domer' position can be adjusted by changing the offset so that it lies just before this sudden change on the graphs.

The 'In Domer' position should occur in the region where the punch is held firmly in the dome station. On the graphs, this region can be identified as the relatively stable region that occurs after the sudden change when the punch nose first makes contact with the dome station and before the ram 'whips' away at the start of the return stroke. If the dome station is not perfectly aligned, when the punch nose withdraws out of the dome station the ram will spring back towards its natural position causing a 'whipping' vibration. This vibration will show up clearly on the graphs.

There is a parameter called "Scaling factor for rigidity of domer support structure". This can be set between 1 and 3. Use 1 for CMB Engineering or Standun type bodymakers where the support structure is very rigid. For Ragsdale bodymakers a higher value of around 1.5 or 2.0 may be required. The dome station misalignment will be multiplied by the factor. Start with a value of 1 and only increase it if it is found that the dome station misalignment is consistently under measured. The reason it might be under measured if the domer support structure is flexible is because the ram will be deflected by less than it would be if it were rigid when the punch nose enters the dome tooling.

The measurement of dome station misalignment can be disabled if it is felt that it is not valid. It is an indirect measurement using the deflection of the ram as the punch enters the domer as an indication of the dome station misalignment. This will not be so if the punch nose does not self centalise in the dome tooling, such as is the case with food can tooling when not making cans. Also, if there is a lot of ram vibration on the forward stroke, the ram deflection may be more due to the vibration than the dome station misalignment.

The set-up parameters for the dome station misalignment can be changed after the dynamic measurement has been made and the Misalignment to the Dome Station recalculated. This allows them to be adjusted to their correct positions after the measurement has been taken. To do so, make the required adjustment to the currently loaded Set-Up file and then click on 'Re-calculate Dome Station Misalignment' from the tools menu. To keep the changes, save the data file.

Gauge Positions 1 and 2

Each setup file can hold the setup information for 2 gauge positions (e.g. 1st and 3rd Iron). The names for each are entered by the user and they need to be enabled by ticking the check box to make them active.

Measurement Zone

Each of the gauge ring positions has a 'Measurement Zone' associated with it. This is the portion of the stroke between the point on the forward stroke where the punch nose reaches the sensors of the gauge ring and the corresponding point on the return stroke. It encompasses all three parts of the measurement: forward stroke, doming and return stroke as described in Section 12.1. It is set automatically; the procedure to do so is as follows:

1. In the same way as you would for making a dynamic measurement, place the gauge ring in the tool-pack at the designated gauge position.
2. Start the bodymaker running in continuous mode, again in the same way as for making dynamic measurements, not making cans.
3. After a few strokes or a few seconds, click on the appropriate 'Reset' button.
4. The 'Measurement Zone' will be reset for that gauge position.
5. Stop the bodymaker.

The procedure has to be repeated for the other gauge position.

Resetting the Measurement Zone also sets the hidden information that allows the software to automatically determine the gauge position when carrying out a dynamic measurement in AUTO Data Capture mode. If the software makes an error in determining the gauge position, resetting the Measurement Zones may solve the problem.

Offset (use to make crank angles match bodymaker encoder)

These offsets allow the 'Measurement Zones' to be shifted up or down by an offset to make them match up exactly with the encoder readings. They don't affect the measurement, only the crank angle scale shown on the graphs. If they are set to zero, the mismatch between the graph scale and the encoder reading will, at worst, be only 4 or 5 degrees.

Technical Note

To set these offsets for agreement with the encoder readings:

- 1) Bar the bodymaker forward to the crank angle of the start of the 'Measurement Zone'
- 2) Make a mark on the tool-pack cradle adjacent to the punch nose
- 3) Bar the bodymaker forward to the crank angle given for the end of the 'Measurement Zone'
- 4) Make another mark on the tool-pack cradle adjacent to the new position of the punch nose
- 5) If the two marks are in the same place, the 'Offset' should be left at zero. Otherwise, bar the bodymaker to a position midway between the two marks.
- 6) Adjust the 'Offset' so that the start or end of the 'Measurement Zone' is equal to the crank angle given on the encoder for the position midway between the two marks.

The same value for the offset can be used for the other gauge position, as it is not likely to need to be more than 1 or 2 degrees different. Alternatively, the process described above can be repeated.

18. Expert System

The Expert System produces a report in plain English of the bodymaker alignment. This feature can be used in addition to the Primary and Split Screen Displays to aid interpretation of the results. Alternatively, the Expert System provides the results of the measurement without the need for interpretation of those more complex displays. The user does not therefore have to be skilled in bodymaker alignment or the analysis of graphs to be able to make use of the Free Stroke Analyser.

The software carries out a comprehensive analysis of the data to identify any of the common alignment problems. The nature of these problems is explained in the report and their possible causes given. The alignment of the punch to the toolpack and dome station is given descriptively (in order of severity of misalignment) as either GOOD, MODERATE, SEVERE or EXTREME.

The adjustments needed to improve toolpack and dome station alignment are given graphically, but note that this will not fix some alignment problems, such as bad ram alignment or “drift” in alignment.

The way the Expert System works depends on whether it is called from the Primary or the Split Screen Display. If it is called from the Normal Display, it analyses the single data file that is currently loaded. It will thus analyse the measurement made with the gauge ring in only one position. If, however, it is called from the Split Screen Display, the measurements made at two gauge ring positions are analysed (provided that the two data files are from different gauge positions). By doing so, the results from one data file can be corroborated with those from the other, making the analysis more powerful than the separate analysis of the two data files. Therefore, to get the most comprehensive report, the Expert System should be called from the Split Screen Display that has the data files from both gauge ring positions loaded.

The contents of the report will depend on whether the measurements were made whilst making cans or not. A lot of the bodymaker problems can only be reliably diagnosed if the measurements were made not making cans. For a comprehensive bodymaker assessment, it is therefore recommended that measurements are first made not making cans. If the bodymaker still exhibits problems even after the faults detected from the measurements made not making cans have been remedied, then further information may be obtained from measurements made whilst making cans.